

Route Log Progress Chart

DRAFT Please Note: Errors and Omissions May Exist. Contact the VTrans Mapping Unit with questions or concerns.

DISTRICT TOWN ROUTE VT-109 **BELVIDERE**

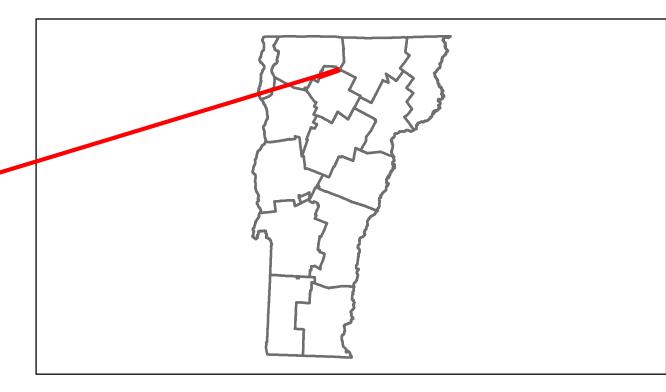

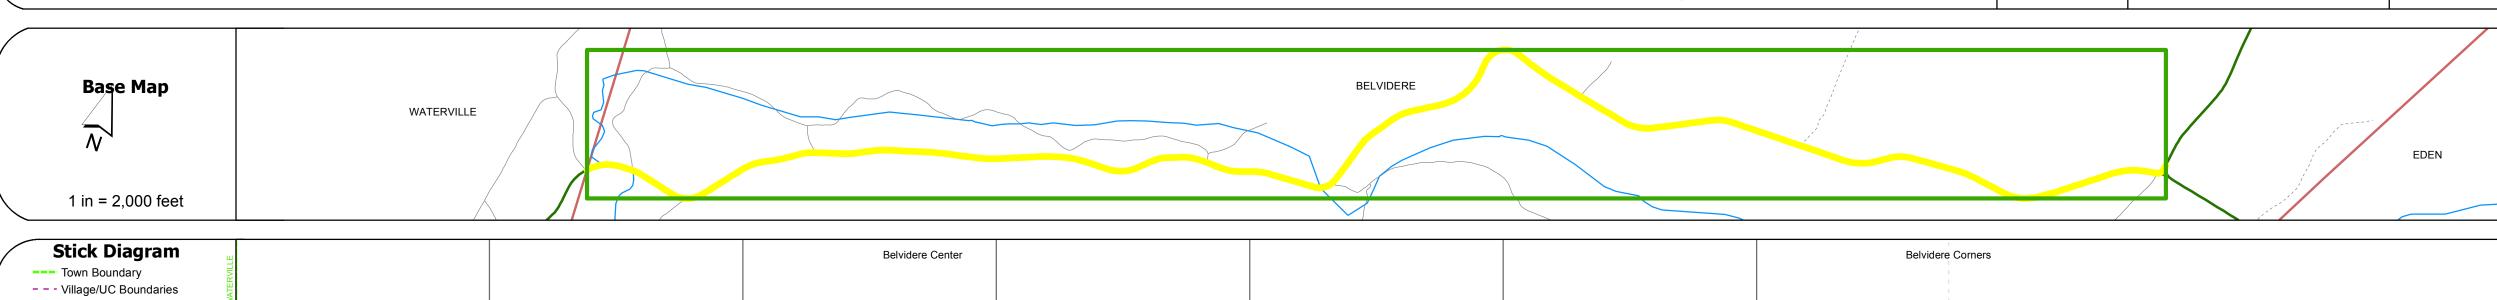

tick Diagram Town Boundary		Belvidere Center			Belvidere Corners	
/illage/UC Boundaries						
District Boundaries State/Town Highway Change	2 +					
Divided Highway Limits	36 R D Π			(LT-1) (LT-1) 3)		
Ghost Section Boundary FAU Limits	N N N N N N N N N N N N N N N N N N N	0 (11+2)	### ### ### ### ### ### ### ### ### ##	109 TRL		
Streams Fown Center	MORGA	BAOK R	011) Q2 WIT	11		
Primary Structures					ROUTE 118N (VT-118)	
Secondary Structures North B Lamo		North Branch Lamoille River	Rattling Brook	Otter Brook	 	
Stations (Feet)		BG RD E			06 RD (TI	
⊢Railroad Crossings	MOUNTY	M M			ROUTE.	
ivided State Highway tate Highway	NPAWAY					
Divided Class 1 Town Highway	2	133		088	68	
Class 1 Town Highway	173	13308	2743	27635 276	2251 - 1	
1 INCH = 2000 FEET			N N	N N N N N N N N N N N N N N N N N N N	8 4	
0		2)	(4)			
Travellane -	20	→		18		
Roadway		26			<u> </u>	

Travellane		26	18	
Road Widths Lane Count		2		
Base	ĺ		4" Reclaimed Existing Pavement	
Subbase	←	18" Gravel	-	
Curves	6 5 5 3 6.3 6.3	6 6 12.5 14 4.7	5.5 4.5 6 2.5 4 4 5 45 45 6 45 6 45 6 45 6 45 6 45	
Grades	+10.0		-9.4 -6.7 -8.8 +5.4 +8.2	
	+10.0		T0.4 T0.2	
Historic Projects				
mstoric Projects				
	2006: STP 2219(1)S			
			1991: RS 0282(6)	
	1500. CHIMOWI		1991: RS 0282(6)	
	1984: HMA 2473		1982: RS 0282(2)	
	1973: Unknown 1979: Unknown			
	1964: S 0282(1) 1971: Unknown		1961: S 0283	
Maintenance Garage		District 8 - Cambridge Garage		
Hamtenance Garage				
Tuessa Countain			φ	
Traffic Counters			S6L120	
				1
Functional Class		7		
Speed Zone	SPEED SPEED LIMIT			
2012	850	><	430	
2011 AADT Counts 2010	850		470	
	840 420		500	
	900 450	• •	520	
2009	· ×	><		
2008	950 470	><	530	

		1904. NIVIA 2473			1902. R5 0202(2)		
		1973: Unknown	detected detected 1979: Unknown				
		1973: Unknown 1964: S 0282(1)					
		1964: S 0282(<u>1</u>)	1971: Unknown			1961	: S 0283(1)
Maintenance Garage				District 8 - Cambridge Garage			
						0	
Traffic Counters						Y S6L120	
Functional Class				7			
Speed Zone			SPEED LIMIT 40				
Speed Zone			40 30				
201: AADT Counts 2010	850	360			430		
	12			→			
	11 850	390		>	470		→
	040	420			500		
	10 400 900			 	500		
	09 ← 900 → ←	450		→	520		→
	050	470			530		
200	08 (950) + (─ ┦ │
201	12						
Crash Locations 2011 2010 2009	11						
	10						
200	08			 			-

DESCRIPTION BLOCK

Bridge 7: Stringer/multi-beam or girder - 1939 Structure No. 200282000708012 Length: 84' Width: 29.2' Facility Carried: VT 00109 ML Bridge Type: ROLLED BEAM Features Intersected: N. BRANCH LAMOILLE R Surface: Bituminous Maintenance/Ownership: State

Bridge <mark>10</mark>: Tee Beam - 1930 Structure No. 200282001008012 Length: 43' Width: 20.1' Facility Carried: VT 00109 ML Bridge Type: CONCRETE T-BEAM Features Intersected: N. BRANCH LAMOILLE R Surface: Bituminous Maintenance/Ownership: State

Culvert 11: Culvert - 1953 Structure No. 300282001108011 Length: 16' Under Clearance: 12.42' Facility Carried: VT109 Bridge Type: RC BOX Features Intersected: RATTLING BROOK Maintenance: State Culvert 12: Culvert - 1960

Structure No. 300282001208011 Length: 11' Under Clearance: 7.5' Facility Carried: VT109 Bridge Type: MULTIPLATE PIPE ARCH Features Intersected: OTTER BROOK Maintenance: State